

Service Bulletin No: 25-015

Ref No: 191

Modification No: Inspection

ATA Chapter: 25

**EQUIPMENT AND FURNISHINGS - GENERAL EQUIPMENT AND FURNISHINGS
INSPECTION OF THE HARLEY-TYPE BUCKLE ASSEMBLIES ON THE SEAT HARNESSSES****1. Planning Information****A. Effectivity**

All PC-7 aircraft.

All seats held as spare or in stock.

All harnesses held as spare or in stock.

B. Concurrent Requirements

None.

C. Reason**(1) Problem**

There has been a reported incident where the adjustable shoulder strap of a seat harness was found to be unattached to the main harness. Subsequent investigation concluded that one of the two release bar retaining screws located on Harley-type buckle assemblies was missing and the other one was loose and could be unscrewed by hand.

(2) Solution

An inspection is done to the Harley-type buckle assemblies on the seat harnesses of the seats in accordance with IrvinGQ Service Bulletin IGQSB033:

- If no movement is found in the two release bar retaining screws, no further action is required
- If movement is found in the two release bar retaining screws, the seat harnesses must be repaired.

D. Description

This Service Bulletin gives the data and instructions necessary to inspect and to repair the Harley-type buckle assemblies on the seat harnesses of the seats in accordance with the IrvinGQ Service Bulletin IGQSB033.

Revision No. 1 is issued to update the Solution, Description and Accomplishment Instructions paragraphs to include in-service rectification actions, if movement is found in the two release bar retaining screws.

Operators that have accomplished this Service Bulletin to the initial issue and found no movement in the two release bar retaining screws - no further work is required.

Operators that have accomplished this Service Bulletin to the initial issue and found movement in the two release bar retaining screws must return to the work area and carry out Para. 3 and Para. 4.

E. Compliance

Mandatory.

Accomplishment is required before the next flight.

F. Approval

The technical content of this Service Bulletin is approved under the authority of Letter of DOA Acceptance ref. FOCA.21J.002.

Pilatus advises Operators/Owners to check with their designated Airworthiness Authorities for any changes, local regulations or sanctions that may affect the embodiment of this Service Bulletin.

G. Copyright Information

© Pilatus Aircraft Ltd. This document contains proprietary information that is protected by copyright. All rights are reserved. No part of this document may be copied, reproduced or translated to other languages without the prior written consent of Pilatus Aircraft Ltd.

H. Manpower

Refer to the IrvinGQ Service Bulletin IGQSB033.

I. Weight and Balance

Not changed.

J. Electrical Load Data

Not changed.

K. Software

Not changed.

L. References

IrvinGQ Service Bulletin IGQSB033.

M. Publications Affected

None.

N. Interchangeability of Parts

Not applicable.

2. Material Information**A. Material - Price and Availability**

No Modification Kit is necessary to do this Service Bulletin.

Operators who require further information on Price and Availability should contact their Customer Liaison Manager at:

Pilatus Aircraft Ltd,
6371 Stans,
Switzerland.

Operators are requested to advise Pilatus Aircraft Ltd. of the Manufacturer's Serial Number (MSN), the flying hours and landings of aircraft which are allocated for this Service Bulletin using the Service Bulletin Evaluation Form.

B. Material Necessary for Each Aircraft**(1) Material to be Procured**

None.

(2) Operator Supplied Materials

Refer to IrvinGQ Service Bulletin IGQSB033.

C. Material Necessary for Each Spare

None.

D. Re-identified Parts

Not applicable.

E. Tooling - Cost and Availability

Refer to IrvinGQ Service Bulletin IGQSB033.

3. Accomplishment Instructions (On Aircraft)**A. Inspection**

- (1) Do an inspection of the Harley-type buckle assemblies on the seat harnesses of the seats in accordance with IrvinGQ Service Bulletin IGQSB033:
 - If no movement is found in the two release bar retaining screws, no further action is required
 - If movement is found in the two release bar retaining screws, do the in-service rectification actions given in the IrvinGQ Service Bulletin IGQSB033.

B. Test

Not applicable.

C. Close-Up

- (1) Refer to IrvinGQ Service Bulletin IGQSB033.
- (2) Remove all equipment, materials and tools from the work area. Make sure that the work area is clean.

D. Documentation

- (1) Make an entry in the Aircraft Logbook that this Service Bulletin has been incorporated.
- (2) Use the Service Bulletin Evaluation Sheet and report your results and the serial number of the aircraft to Pilatus.

4. Accomplishment Instructions - (Seats and all Harnesses Held as Spares or in Stock)

- A. Do an inspection of the Harley-type buckle assemblies on the seat harnesses of the seats in accordance with IrvinGQ Service Bulletin IGQSB033:
- If no movement is found in the two release bar retaining screws, no further action is required
 - If movement is found in the two release bar retaining screws, do the in-service rectification actions given in the IrvinGQ Service Bulletin IGQSB033.
- B. Documentation
- (1) Make an entry on the equipment label that this Service Bulletin has been accomplished.
 - (2) Use the Service Bulletin Evaluation Sheet and report your results.

INTENTIONALLY BLANK

SERVICE BULLETIN EVALUATION SHEET FOR SB No. 25-015			
Title	Equipment and Furnishings - General Equipment and Furnishings - Inspection of the Harley-Type Buckle Assemblies on the Seat Harnesses		
Customer			
Service Center			
EMBODIMENT REPORTING			
This SB has been embodied:		<input type="checkbox"/>	On the entire fleet
		<input type="checkbox"/>	Only partially
Provide embodiment details per aircraft (use additional copies of this table, if necessary)			
MSN	Flying Hours	MSN	Flying Hours
Additional embodiment comments/findings			
EDITORIAL COMMENTS (procedure, kit quality, suggested improvements, etc.)			
Name	Signature	Date	
Please complete and forward this form to: Pilatus Aircraft LTD, Customer Technical Support (MCC), P.O. BOX 992, 6371 Stans, Switzerland Fax: +41 (0)41 619 6773 Email: Techsupport@pilatus-aircraft.com			

SERVICE BULLETIN EVALUATION SHEET

INTENTIONALLY BLANK